

A.B.I SERVICE BULLETIN FOR CHRYSLER APPLICATIONS / BULLETIN DE SERVICE POUR LES APPLICATIONS DE CHRYSLER

PROBLEM On these application brake noise may be caused by chatter, clunking and clicking may occur


CAUSE The anchor rail may be worn over time, creating excessive clearance between guide rails and pads

SOLUTION Install our ABI-H91984 reparation kit to reduce the clearance between the pads and guide rails

This kit contains universal abutment clips of various thickness to reduce clearance between the disc pad and the guide rails

7358-D477	97-02 JEEP CHEROKEE, 93-98 GRAND CHEROKEE, 98-03 WRANGLER, 90-92 COMANCHE
7404-D522	91-95 TOWN&COUNTRY, 91-95 LEBARON, 91-93 DAYTONA, 91-95 FIFTH AVENUE & NEW YORKER 91-95 CARAVAN & SPIRIT, 91-94 SHADOW, 91-93 DYNASTY, 91-95 VOYAGER & ACCLAIM, 91-94 SUNDANCE 92-94 DUSTER
7403-D521	91-97 VOYAGER, 91-93 ACCLAIM, 91-94 TOWN&COUNTRY, 91-95 LEBARON, 91-94 CARAVAN, 91-93 DAYTONA, 91-93 SPIRIT,
7470-D591	94-97 LHS & NEW YORKER, 96-00 TOWN&COUNTRY, 93-97 CONCORD, 96-00 CARAVAN, 93-97 CONCORD, 96-00 CARAVAN, 93-97 INTREPID & VISION, 96-00 VOYAGER, 97-00 CHEROKEE, 97-98 GRAND CHEROKEE, 98-02 WRANGLER,
7470-D642	95-97 NEON
7518-D642	
7616-D746	98-02 DURANGO, 99-02 DAKOTA
7616-D820	00-02 DURANGO, DAKOTA

- 1 - remove old pads and clean guide rails
- 2 - apply a thin film of moly lube to both guide rails
- 3 - install new ALCO pads with appropriate size abutment clip to reduce between pad and guide rails
- 4 - always attach clips on the trailing edge of the pad

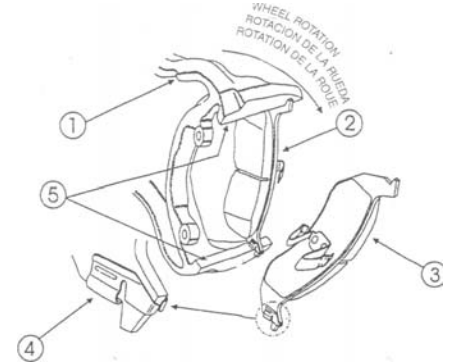

cet ensemble contient des cales d'espacement de dimensions variés pour réduire l'espace entre les plaquettes et les guides de plaquettes

le probleme sur ces vehicules les freins peuvent causer un bruit de calquement ou de criage

la cause les guides de plaquettes usent créant un jeu excessif entre la plaquette et le guide de support

la solution installer notre ensemble de cales ABI-H91984 pour réduire l'espacement entre les plaquettes et le guide

- 1 - enlever les vieilles plaquettes et nettoyer les guides de plaquettes
- 2 - appliquer un film de lubrifiant moly sur les guides
- 3 - installez des plaquettes neuves ALCO avec les cales appropriée
- 4 - fixez toujours les cales sur le coté de charge des plaquettes

PROBLEM brake noise and brake not returning to their position properly

CAUSE not reinstalling or non replacement of return clips

SOLUTION installing ALCO repair kit H-D591

7470-D591	CHRYSLER VARIOUS MODEL 1998-2002
------------------	----------------------------------

the spring clips will help the pads to return to their resting position. Often omitted after pad service, the clips are not installed.

We recommend installing/replacing the clips every time front pads are serviced for optimum braking performance



LE PROBLEME bruit des freins et les freins ne retourne pas a leur position correctement

LA CAUSE non remplacement ou la non installation de ressorts de retour

LA SOLUTION installer le kit de reparation ALCO H-D591

7470-D591	CHRYSLER MODELE VARIÉS 1998-2002
------------------	----------------------------------

les ressorts de retour aideront les plaquettes a retourner a leur place initiale. Souvent omis pendant le service des freins avant les ressorts ne sont pas installé.

Nous recommandons d'installer ou de remplacer l'ensemble lors du service des plaquettes avant pour des performance de feinage optimum.

